



TECHNICAL BULLETIN

➤ *Advisory* ◀

www.mceinc.com

Reference # 148
Route to **Modernization Manager**
From MCE Technical Support Department (916-463-9200 then press "3")
Date February 15th 2014
Pages 1

Subject **iControl start up requires DOL Input for Construction Mode**

Equipment All "i" Series Controllers.

Description In a limited number of iControl installations, it has been brought to MCE's attention that during controller installation "Construction Mode", DOL and DOLR need to be jumped to move the car if the actual door operator inputs are not available. In the past, this input is not necessary for Construction Mode.

Software versions that are affected by this are IMP 2.4.66 and above and IMP version 3.1.29 and above.

Action If you are experiencing problems moving the car during construction and the IMP software is in the range above, please temporarily jump DOL (and DOLR if rear doors are present) to the correct power bus shown on the prints to move the car. Be sure to follow all safety procedures when jumping out safety circuits.

MCE Help As always, should you require any additional technical assistance on this or any other issues:

- **Email: techsupport@nidec-mce.com**
- **Refer to the reference number above**