

IMPORTANT

Engineering Bulletin #113 Failures on 3-Pole Plug-in Relays on Tricon Controllers

O. Thompson Co.

84-00 73rd Ave. Unit F


Glendale NY 11385

(718) 417-3131

(718) 417-9075 fax

Tricon Plug-in Relay Failures

O. Thompson has experienced an unacceptable rate of failure on the 3-pole plug-in relays on the Relay Board of Tricon car controllers. The effected relays carry part number **EQU14D35F-DC110**. Not all relays with this number are effected, though. To determine if the relay needs to be replaced, look at the coil inside the relay. If the coil is white, the relay should be replaced. If the coil is black, the relay will work properly and does not need to be replaced. See the pictures below for identification of the effected relays.

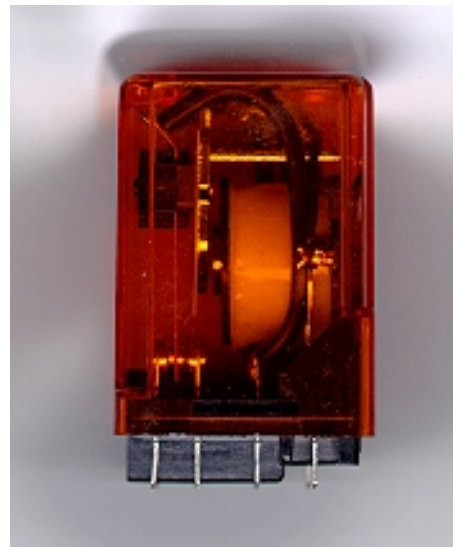

O. Thompson will supply new relays at no charge to replace the existing relays. To order the replacement parts, please contact O. Thompson Technical Support at (718) 417-3131.

© Copyright 2001 O. Thompson Co.

Released 6/13/01